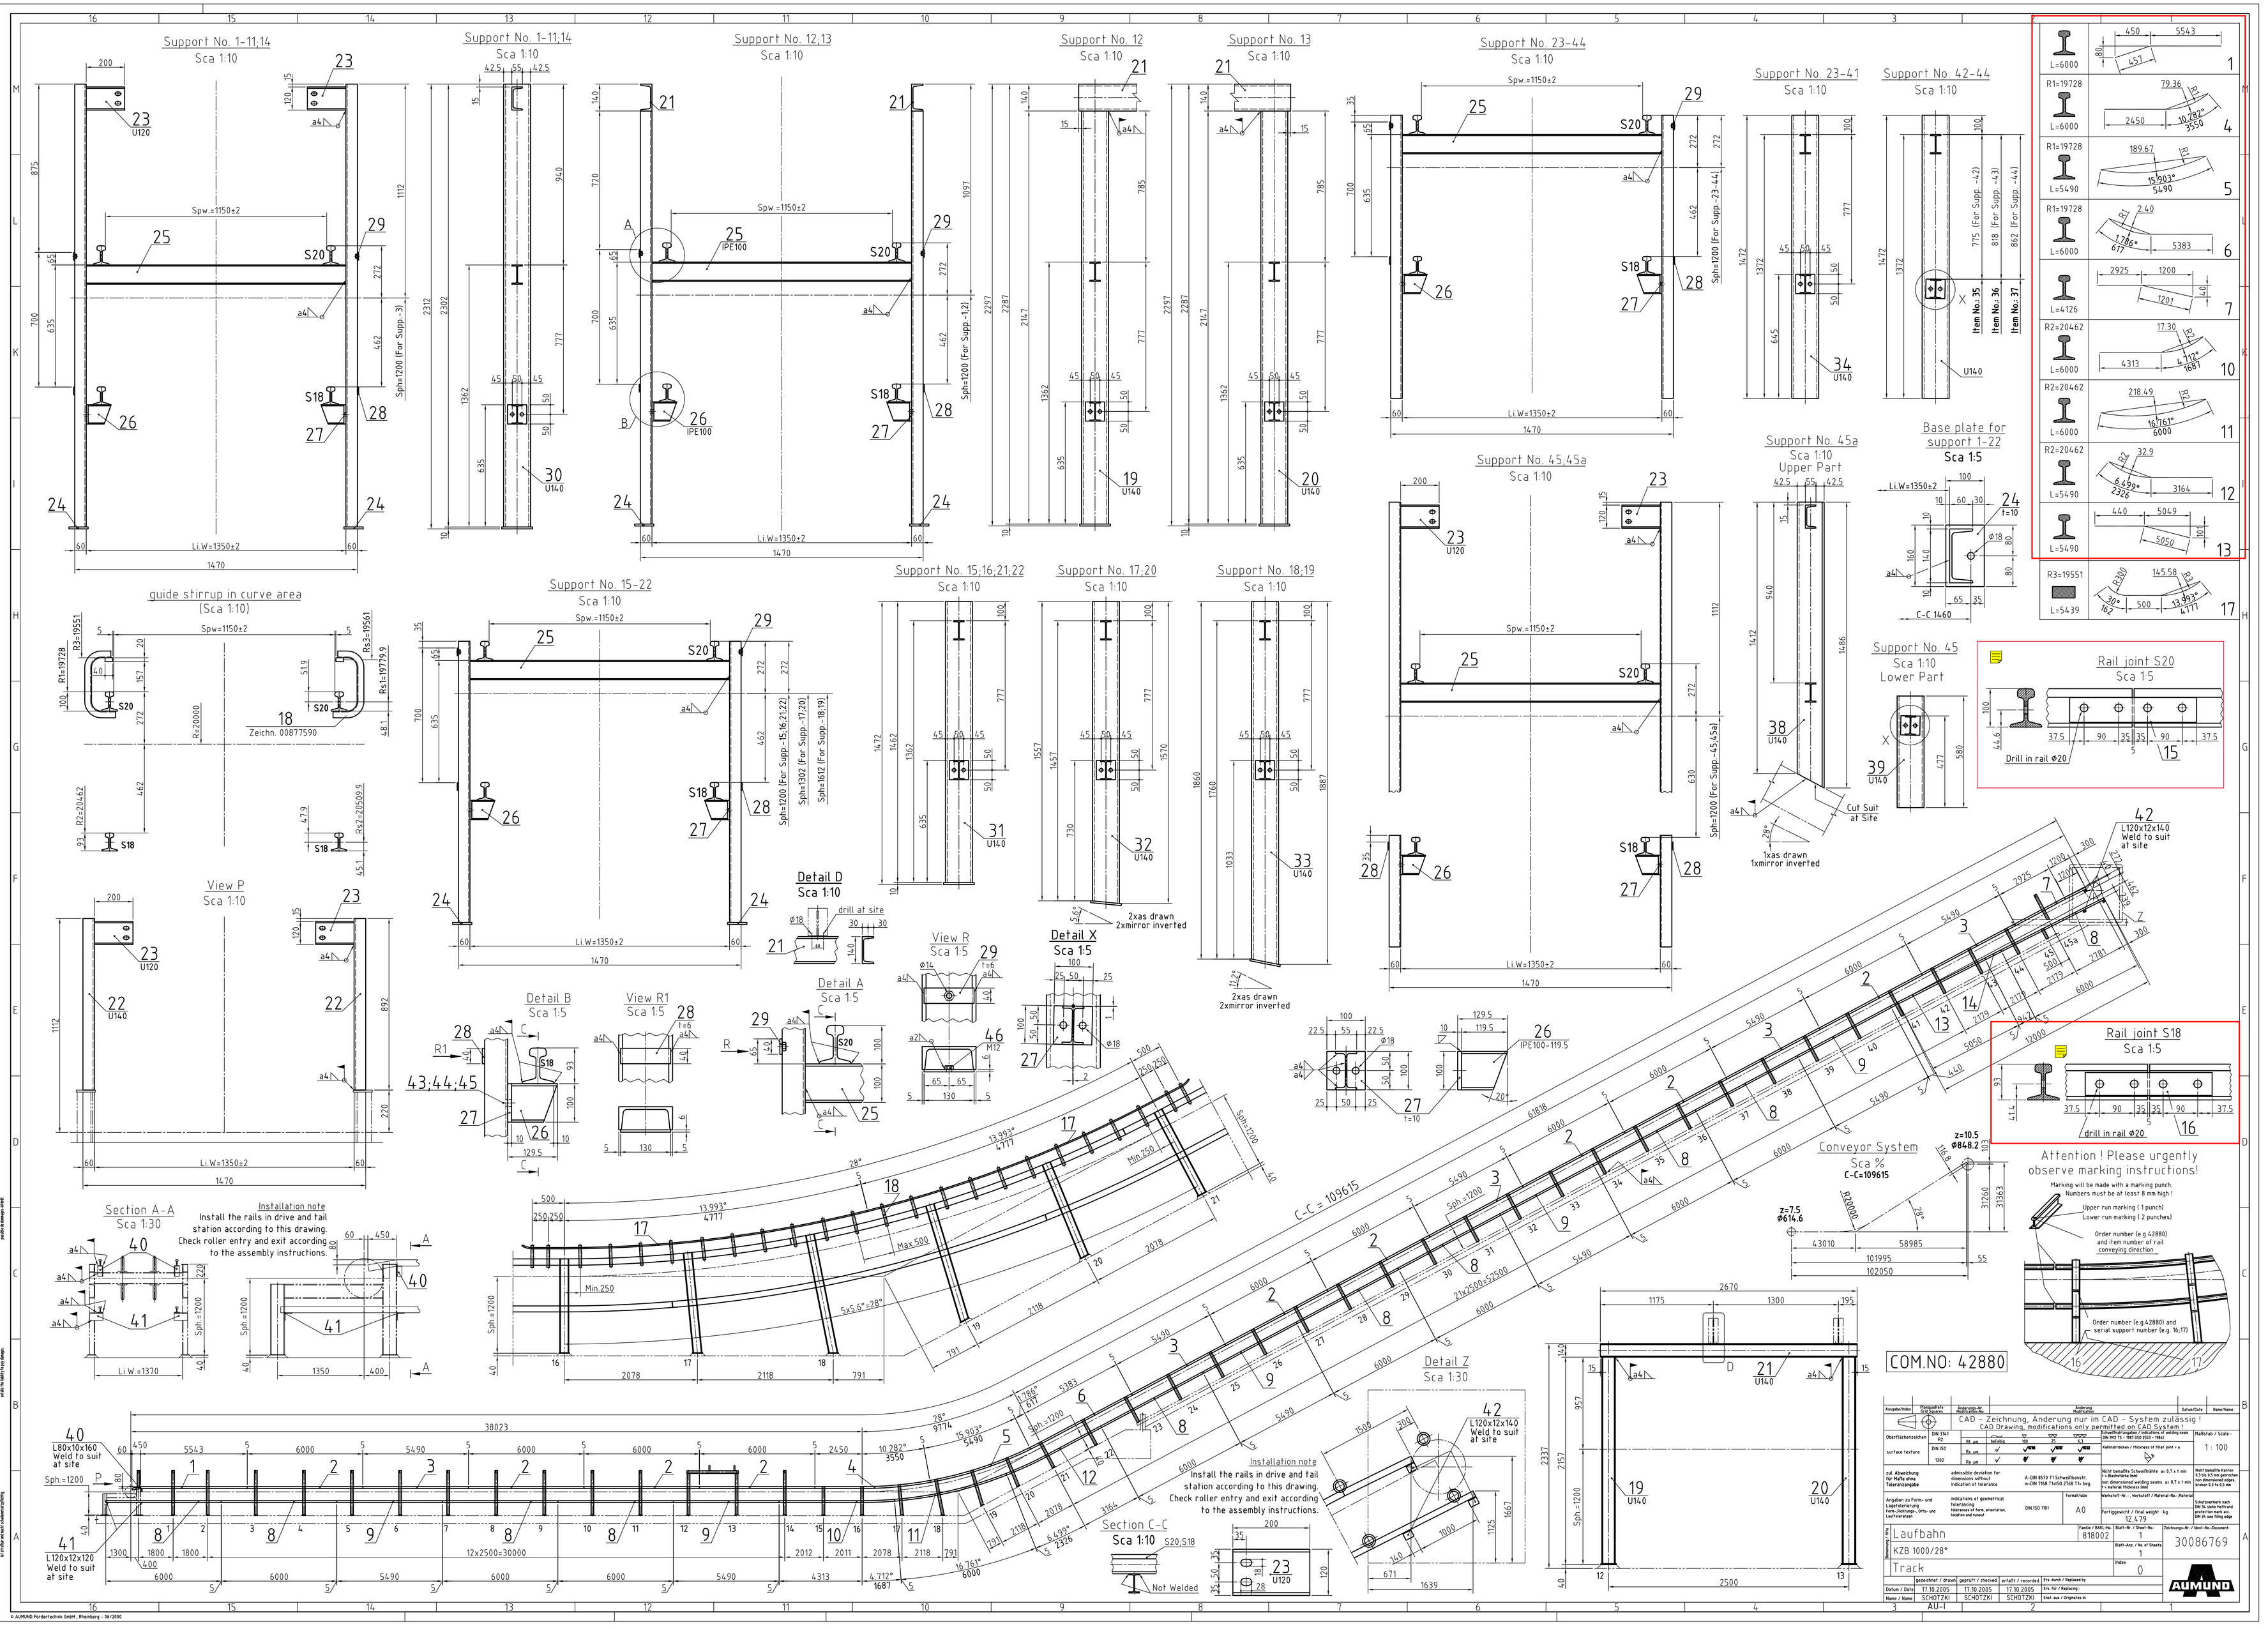
Support No. 1-11,14
Sca 1:10
Support No. 12,13
Sca 1:10
Support No. 12
Sca 1:10
Support No. 13
Sca 1:10
Support No. 23-44
Sca 1:10
Support No. 23-41
Sca 1:10
Support No. 42-44
Sca 1:10
Support No. 45,45a
Sca 1:10
Support No. 45a
Sca 1:10
Upper Part
Base plate for support 1-22
Sca 1:5
Support No. 45
Sca 1:10
Lower Part
Rail joint S20
Sca 1:5
Rail joint S18
Sca 1:5
guide stirrup in curve area
(Sca 1:10)
Support No. 15-22
Sca 1:10
Support No. 15;16;21;22
Sca 1:10
Support No. 17;20
Sca 1:10
Support No. 18;19
Sca 1:10
View P
Sca 1:10
Detail D
Sca 1:10
View R
Sca 1:5
Detail X
Sca 1:5
Detail A
Sca 1:5
Detail B
Sca 1:5
View R1
Sca 1:5
Section A-A
Sca 1:30
Installation note
Install the rails in drive and tail station according to this drawing. Check roller entry and exit according to the assembly instructions.
Section C-C
Sca 1:10
Not Welded
Detail Z
Sca 1:30
Conveyor System
Sca %
C-C=109615
Attention ! Please urgently observe marking instructions!
Marking will be made with a marking punch.
Numbers must be at least 8 mm high !
Upper run marking (1 punch)
Lower run marking (2 punches)
Order number (e.g.42880) and item number of rail conveying direction
Order number (e.g.42880) and serial support number (e.g. 16;17)
COM.NO: 42880
CAD – Zeichnung, Änderung nur im CAD – System zulässig !
CAD Drawing, modifications only permitted on CAD System !
Laufbahn
KZB 1000/28°
Track
818002
30086769
AUMUND